


Cable to Ground Rod

Mold Information

- Molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number. i.e. 4S = 4 AWG solid conductor.
- Molds listed are for tapered ground rods. For threaded sectional rods, add suffix "S" after the ground rod number. i.e. 58S = 5/8" sectional ground rod.
- Molds with Price Key "L" and "M" SOLD WITH HANDLES.
- Handles for "L" and "M" Price Key Molds DO NOT INCLUDE Flint Igniters.
- If Handles not required, add suffix "-x" after Mold Part. No.
- Price Key is the **Bold Letter** in the Mold Part. No.
- For mold Wear Plates, add suffix "WP" to the end of the Mold Part No.

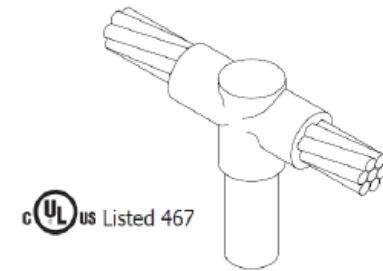

GO

(Horizontal Thru Cable to
Top of Ground Rod)

Required Tools & Accessories

- MH1 - Handle for "B" Price Key Molds
- MH2 - Handle for "C" Price Key Molds
- FLTIG - Flint Igniter when Price Key is "L" or "M"

Recommended Tools & Accessories

- CCBRSH1 - Cable Cleaning Brush
- MCBRSH1 - Mold Cleaning Brush

GO Connection Type

Ground Rod Size	Cable Size	Mold Part No.	Weld Metal - Ultrashot	Weld Metal - NUWTUBE
1/2"	#6	GO-126L	US32	NUWTUBE32
	#4	GO-124L	US32	NUWTUBE32
	#2 Sol	GO-122SB	US90	NUWTUBE90
	#2	GO-122B	US90	NUWTUBE90
	1/0	GO-121/OB	US90	NUWTUBE90
	2/0	GO-122/OB	US90	NUWTUBE90
	3/0	GO-123/OB	US115	NUWTUBE115
	4/0	GO-124/OB	US115	NUWTUBE115
	250 MCM	GO-1225CMB	US150	NUWTUBE150
	300 MCM	GO-123/CMB	US200	NUWTUBE200
5/8"	#6	GO-586L	US32	NUWTUBE32
	#4	GO-584L	US32	NUWTUBE32
	#2 Sol	GO-582SB	US90	NUWTUBE90
	#2	GO-582B	US90	NUWTUBE90
	1/0	GO-581/OB	US90	NUWTUBE90
	2/0	GO-582/OB	US90	NUWTUBE90
	3/0	GO-583/OB	US115	NUWTUBE115
	4/0	GO-584/OB	US115	NUWTUBE115
	250 MCM	GO-5825CMB	US150	NUWTUBE150
	300 MCM	GO-583CMB	US200	NUWTUBE200
350 MCM	GO-5835CMB	US200	NUWTUBE200	
500MCM	GO-585CMB	US250	NUWTUBE250	

Ground Rod Size	Cable Size	Mold Part No.	Weld Metal - Ultrashot	Weld Metal - NUWTUBE
3/4"	#6	GO-346L	US45	NUWTUBE45
	#4	GO-344M	US65	NUWTUBE65
	#2 Sol	GO-342SB	US90	NUWTUBE90
	#2	GO-342B	US90	NUWTUBE90
	1/0	GO-341/OB	US115	NUWTUBE115
	2/0	GO-342/OB	US115	NUWTUBE115
	3/0	GO-343/OB	US115	NUWTUBE115
	4/0	GO-344/OB	US115	NUWTUBE115
	250 MCM	GO-3425CMB	US150	NUWTUBE150
	300 MCM	GO-343/CMB	US200	NUWTUBE200
1"	350 MCM	GO-3435CMB	US200	NUWTUBE200
	500 MCM	GO-345CMB	US250	NUWTUBE250
	750 MCM	GO-3475CMC	US400	2-NUWTUBE200
	1/0	GO-101/OB	US150	NUWTUBE150
	2/0	GO-102/OB	US150	NUWTUBE150
	3/0	GO-103/OB	US150	NUWTUBE150
	4/0	GO-104/OB	US150	NUWTUBE150
	250 MCM	GO-1025CMB	US200	NUWTUBE200
	300 MCM	GO-103CMB	US200	NUWTUBE200
	350 MCM	GO-1035CMB	US200	NUWTUBE200
500 MCM	GO-105CMB	US250	NUWTUBE250	
750 MCM	GO-1075CMB	US400	2-NUWTUBE200	
1000 MCM	GO-101MCC	US500	2-NUWTUBE250	


Cable to Cable

PT Connection Type


Cable Size Run	Cable Size Tap	Mold Part No.	Weld Metal - Ultrashot	Weld Metal - NUWTUBE
#6	#6	PT-66B	US25	NUWTUBE25
#4	#8 Sol	PT-48SB	US32	NUWTUBE32
	#8	PT-48B	US32	NUWTUBE32
	#6 Sol	PT-46SB	US32	NUWTUBE32
	#6	PT-46B	US32	NUWTUBE32
	#4	PT-44B	US32	NUWTUBE32
#2 Sol	#2 Sol	PT-2S2SB	US65	NUWTUBE65
#2	#8 Sol	PT-28SB	US45	NUWTUBE45
	#8	PT-28B	US45	NUWTUBE45
	#6 Sol	PT-26SB	US45	NUWTUBE45
	#6	PT-26B	US45	NUWTUBE45
	#4	PT-24SB	US65	NUWTUBE65
1/0	#2 Sol	PT-22SB	US65	NUWTUBE65
	2	PT-22B	US65	NUWTUBE65
	#8 Sol	PT-1/08SB	US65	NUWTUBE65
	#8	PT-1/08B	US65	NUWTUBE65
	#6 Sol	PT-1/06SB	US65	NUWTUBE65
2/0	#6	PT-1/06B	US65	NUWTUBE65
	#4	PT-1/04B	US65	NUWTUBE65
	#2 Sol	PT-1/02SB	US65	NUWTUBE65
	2	PT-1/02B	US65	NUWTUBE65
	1/0	PT-1/01/0B	US90	NUWTUBE90
3/0	#8 Sol	PT-2/08SB	US65	NUWTUBE65
	#8	PT-2/08B	US65	NUWTUBE65
	#6 Sol	PT-2/06SB	US90	NUWTUBE90
	#6	PT-2/06B	US90	NUWTUBE90
	#4	PT-2/04B	US90	NUWTUBE90
	#2 Sol	PT-2/02SB	US90	NUWTUBE90
	2	PT-2/02B	US90	NUWTUBE90
	1/0	PT-2/01/0B	US115	NUWTUBE115
	2/0	PT-2/02/0B	US115	NUWTUBE115
	3/0	PT-2/02/0B	US115	NUWTUBE115
4/0	#8 Sol	PT-3/08SB	US90	NUWTUBE90
	#8	PT-3/08B	US90	NUWTUBE90
	#6 Sol	PT-3/06SB	US90	NUWTUBE90
	#6	PT-3/06B	US90	NUWTUBE90
	#4	PT-3/04B	US115	NUWTUBE115
	#2 Sol	PT-3/02SB	US115	NUWTUBE115
	2	PT-3/02B	US115	NUWTUBE115
	1/0	PT-3/01/0B	US115	NUWTUBE115
	2/0	PT-3/02/0B	US150	NUWTUBE150
	3/0	PT-3/03/0B	US150	NUWTUBE150
4/0	#8 Sol	PT-4/08SB	US90	NUWTUBE90
	#8	PT-4/08B	US90	NUWTUBE90
	#6 Sol	PT-4/06SB	US90	NUWTUBE90
	#6	PT-4/06B	US90	NUWTUBE90
	#4	PT-4/04B	US150	NUWTUBE150
	#2 Sol	PT-4/02SB	US150	NUWTUBE150
	2	PT-4/02B	US150	NUWTUBE150
	1/0	PT-4/01/0B	US150	NUWTUBE150
	2/0	PT-4/02/0B	US150	NUWTUBE150
	3/0	PT-4/03/0B	US200	NUWTUBE200
4/0	PT-4/04/0B	US200	NUWTUBE200	

PS Connection Type

Cable Size Run	Cable Size Tap	Mold Part No.	Weld Metal - Ultrashot	Weld Metal - NUWTUBE
#8 Sol	#8 Sol	PS-8S8SL	US25	NUWTUBE25
#8	#8	PS-88L	US25	NUWTUBE25
#6 Sol	#6 Sol	PS-6S6SL	US25	NUWTUBE25
#6	#6	PS-66L	US25	NUWTUBE25
#4 Sol	#4 Sol	PS-4S4SM	US32	NUWTUBE32
#4	#4	PS-44M	US32	NUWTUBE32
#2 Sol	#2 Sol	PS-2S2M	US45	NUWTUBE45

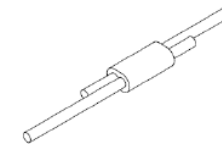

PS
(Parallel Thru Splice of Horizontal Cables)

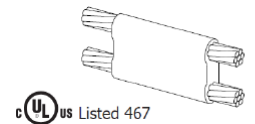

UL US Listed 467

PT
(Parallel Thru Splice of Horizontal Cables, Tap Conductor Over Run)

Mold Information

- **PS** molds listed are for solid or concentric copper conductors.
- **PT** molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number. i.e. 4S = 4 AWG solid conductor.
- Price Key is the **Bold Letter** in the Mold Part. No..
- Molds with Price Key "**L**" and "**M**" **SOLD WITH HANDLES**.
- If Handles not required, add suffix "-x" after Mold Part. No.
- Handles for "**L**" and "**M**" Price Key Molds **DO NOT INCLUDE** Flint Igniters.
- For mold Wear Plates, add suffix "WP" to the end of the Mold Part No.

Required Tools & Accessories

- MH1 - Handle for "**B**" Price Key Molds
- FLTIG - Flint Igniter when Price Key is "**L**" or "**M**"

Recommended Tools & Accessories

- CCBRS1 - Cable Cleaning Brush
- MCBRS1 - Mold Cleaning Brush